

Work Order ID 61191

August 11, 2010 7:43:37 AM



Page 1

Item ID: D2580-1

Accept



Setup Start



Revision ID:

Stop



Item Name: 205 Skidtube bent detail

Start Date: 8/11/10 Start Qty: 2.00



Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 2.00



Customer:

Reference:

Approvals:

Process Plan: CYDate: 10/8/11

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D2580	Rev D

100

0.00



HandFinish

Memo

0.00

Hand Finishing

1- Inspect mat'l D2500-1-190 for damage.

2- Chemical Conversion Coat as per QSI 005 4.1

101

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

2 — AWM
10-08-14

DP

10-8-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 61191

August 11, 2010 7:43:37 AM



Page 2

Item ID: D2580-1

Accept



Setup Start



Revision ID:

Stop



Item Name: 205 Skidtube bent detail

Start Date: 8/11/10 Start Qty: 2.00



Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 2.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

110

0.00



Skidtubes

2 - - *AWM 10-08-16*

Skidtubes

Memo

0.00

1-Drill pilot holes using drill jig DT 8149 (Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580 without cutting fluid

3-Deburr and blow out all chips from inside of tube

4-Bond web in place per QSI 015.

□□

A/R Sikaflex-291 batch: *M115114* □□□

Sikaflex expire date: *11-01-20* - *10-08-16*

Start time and date: *7:30* bond for 12hrs

130

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

*2 - *2ED-0877*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 61191

August 11, 2010 7:43:37 AM



Page 3

Item ID: D2580-1

Accept



Setup Start



Revision ID:

Stop



Item Name: 205 Skidtube bent detail

Start Date: 8/11/10 Start Qty: 2.00



Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 2.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

Identify as per dwg & Stock Location: LG

0.00



Packaging

Memo

0.00

Packaging

2 - BE 10/08/17

150

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

10/08/18 AD

MF
10-8-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

August 11, 2010 7:43:37 AM

Page 1

Work Order ID: 61191



Parent Item: D2580-1



Parent Item Name: 205 Skidtube bent detail

Start Date: 8/11/10

Required Date: 8/16/10

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP B 01.11.08 Revised Step 9, 10, 12, and 13 SM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured

No

Each

106.0000

1

2



Ext'n -1' Beam Tube 4"

Location

Loc Qty

Loc Code

LG

106

52319

29

58427

77

D2596

Manufactured

No

110

Each

0.0000

1

2



Web, 205 Skidtube

AWM 10-08-14 (2)

B-6263

AWM 10-08-16 (2)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY SCALE NTS	
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 *[Signature]*

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 101191
CL 10/8/11


GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).


Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


DETAIL A
SCALE 5:24

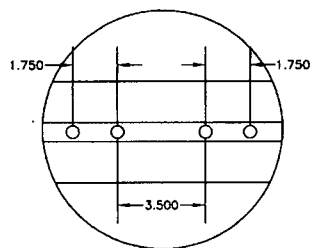


DETAIL B
SCALE 5:24

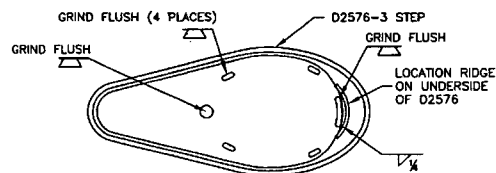


D2580-1 DRILLING DETAIL

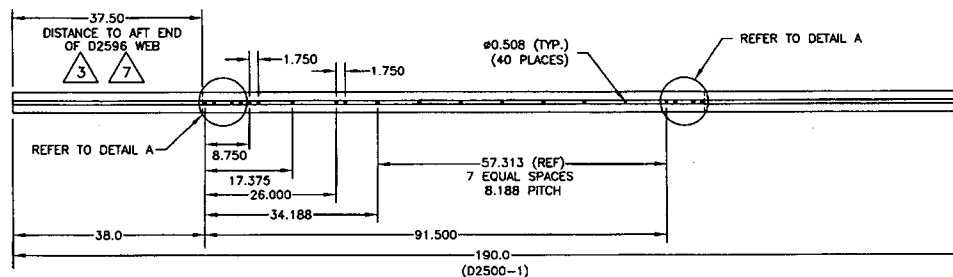

D2580-1 BENDING AND CUTTING DETAIL

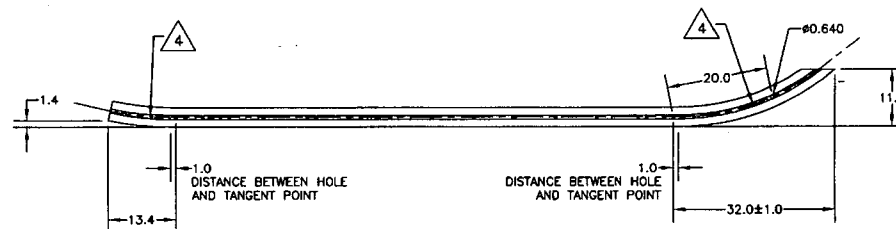


DETAIL C
SCALE 5:24

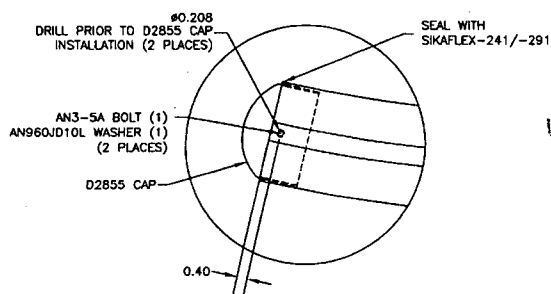


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 61191

SECTION D-D
SCALE 5:24

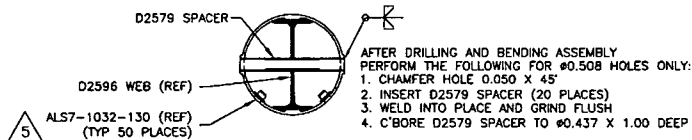

D2580-041 ASSEMBLY DETAIL

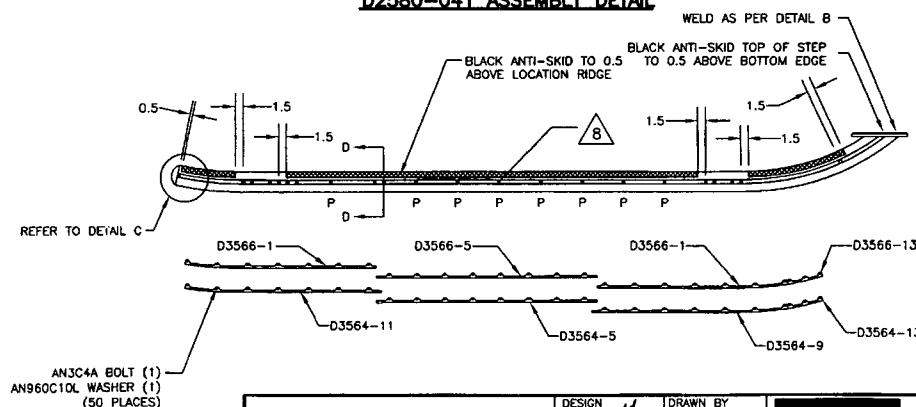

D2580-041 NOTES

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN	DRAWN BY
CHECKED	APPROVED
DATE	

DART DART AEROSPACE LTD.
HAMPSHIRE, ONTARIO, CANADA

DRAWING NO.	REV. D
D2580	SHEET 2 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

RELEASED
07-06-28

Diagram illustrating the grinding locations for the propeller cross-section:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{8}$

Technical drawing of a circular component, likely a cap or cover, showing various callouts and dimensions:

- #0.208**: Dimension for the central hole.
- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)**: Instruction for drilling two locations.
- SEAL WITH SIKAFLEX-241/-291**: Instruction for sealing the component.
- AN3-SA BOLT (1)**: Callout for a bolt.
- AN960/JD10L WASHER (1) (2 PLACES)**: Callout for a washer.
- D2855 CAP**: Callout for the cap.
- SEE NOTE ii)**: Reference to a note.
- 0.40**: Dimension for the thickness of the component.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO 6612

D2579 SPACER

D2596 WEB (REF)

AL57-1032-130 (REF)
 (TYP 50 PLACES)

AFTER DRILLING AND BENDING ASSEMBLY
 PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE
WITH THE SPACER AT THIS LOCATION


[illegible]

(MAKE FROM D2380-1 DRILLING DETAIL)

Technical drawing of a curved pipe section. Dimensions and callouts include:

- Overall length: 51.340
- Distance from left end to first hole: 5.985
- Distance between first and second holes: 5.338 (REF)
- Distance from second hole to third hole: 3.630 (REF)
- Distance from third hole to fourth hole: 39.580
- Distance from fourth hole to end: 5.915
- Hole diameter: $\phi 0.508$ (8 PLACES)
- Radius of curvature: 20.0
- End diameter: $\phi 0.640$
- Distance between hole and tangent point (left): 1.0
- Distance between hole and tangent point (right): 1.0
- Overall distance between tangent points: 32.0 \pm 1.0
- Callout 4 points to specific features.

 [illegible]

COPYRIGHT © 1996 BY DART AEROSPACE LTD.		DESIGN RH		DRAWN BY RH		 DART AEROSPACE LTD. MARKHAM, ONTARIO, CANADA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED H	APPROVED H		DRAWING NO. D2580		REV. 0
		DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY		SHEET 3 OF 3	

$$\begin{array}{r} 71 \\ 50 \\ \hline 129 \end{array}$$